


# TPMS DIAGNOSE

## EASY INSTRUCTIONS

- Select TPMS Diagnose from the main menu
- Follow the on-screen TPMS Diagnose Guide  
Trigger all sensors and connect TS508 via OBDII cable
- In case of a duplicate sensor ID, a **D** will appear
- If the sensor does not trigger an **X** will appear

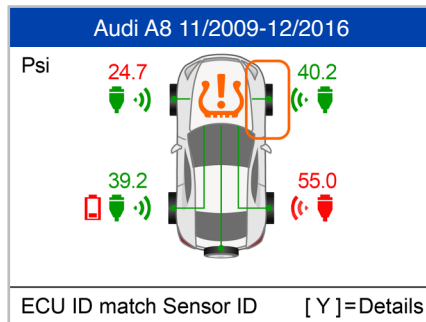

Trouble codes present in the TPMS Control Module.



Battery in the sensor is low.

35.7  
56.7

Adjust pressures displayed in red to match Placard Sticker.



There is no sensor ID present in the TPMS Module. The sensor will not activate and requires replacement.



No Trouble codes present in the TPMS Control Module.



The sensor ID matched the ID stored in the TPMS Module.



The sensor ID does not match the ID stored in the TPMS Module.



Sensor will not activate and must be replaced. Original ID is stored in the TPMS Module.

**AUTEL** IS THE **ONLY** TPMS MANUFACTURER TO OFFER A

# COMPLETE



# SOLUTION

POWERFUL SCAN TOOLS

HIGH QUALITY SENSORS



MAXITPMS TS508

- MOST CURRENT VEHICLE COVERAGE
- BEST TOOL & SENSOR COMPATIBILITY
- QUICKEST TPMS SERVICE & REPAIRS
- EASY - TO - USE TOOL NAVIGATION



MX-SENSOR 1-SENSOR



Phone: (855) 288-3587 • [USSUPPORT@AUTEL.COM](mailto:USSUPPORT@AUTEL.COM)  
[AUTEL.COM](http://AUTEL.COM) • [MAXITPMS.COM](http://MAXITPMS.COM) • [MAXISYSADAS.COM](http://MAXISYSADAS.COM)

©2019 Autel Intelligent Technology Corp., Ltd., All Rights Reserved



Follow Us @AutelTools

